

1305303

sport

Bmw S62 B50 394hp
V-8cyl 4.9L 32v QOHC

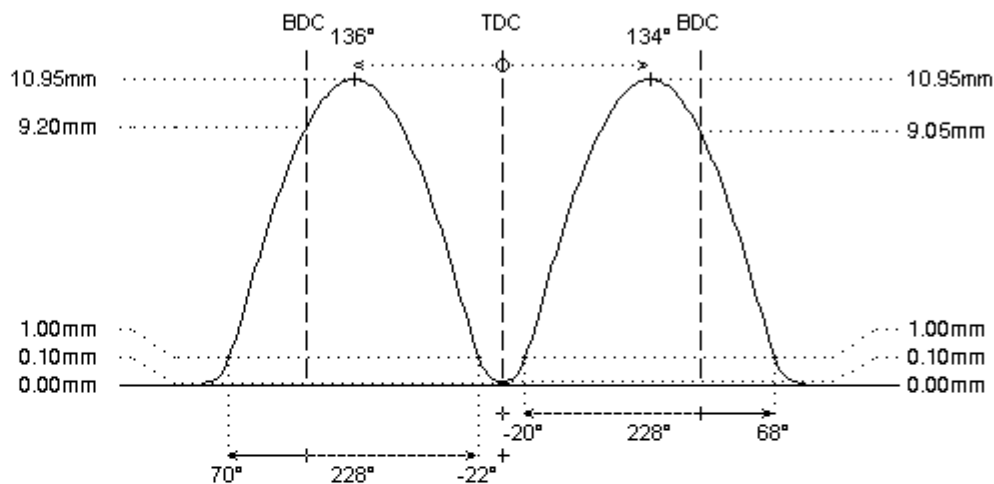


	intake	exhaust
camshaft data:		
lash ramp	: hydro	hydro
duration @ 0.1mm	: 267°	267°
duration @ 1.0mm	: 228°	228°
valve lift	: 10.95mm	10.95mm
cam lift	: 10.95mm	10.95mm
lobe angle	: 134°	136°
timing @ 1.0mm	: -20° / 68°	70° / -22°
valve lift @ TDC	: 0.10mm	0.10mm

parts setup:

cam wheels :	:	:
follower	: O.E.M.	: O.E.M.
valve lash	: O.E.M.	: O.E.M.
valve	: O.E.M.	: O.E.M.
valve locks	: O.E.M.	: O.E.M.
upper retainer	: O.E.M.	: O.E.M.
lower retainer	: O.E.M.	: O.E.M.
exterior spring	: O.E.M.	: O.E.M.
interior spring	:	:

fitted load / length	: 0kg @ 0.0mm	: 0kg @ 0.0mm
max. load / lift	: 0kg @ 0.0mm	: 0kg @ 0.0mm

REMARKS :**REMARKS :**

- # Check distance between valves and piston to be 1mm at least with VVT engaged. Wrong installation will cause severe engine damage!