

1305752

sport

Bmw S65 B40 414hp
V-8cyl 4.0L 32v QOHC



	intake	exhaust
camshaft data:		
lash ramp	: hydro	hydro
duration @ 0.1mm	: 274°	274°
duration @ 1.0mm	: 236°	236°
valve lift	: 11.50mm	11.50mm
cam lift	: 11.50mm	11.50mm
lobe angle	: 130°	129°
timing @ 1.0mm	: -12° / 68°	67° / -11°
valve lift @ TDC	: 0.20mm	0.25mm

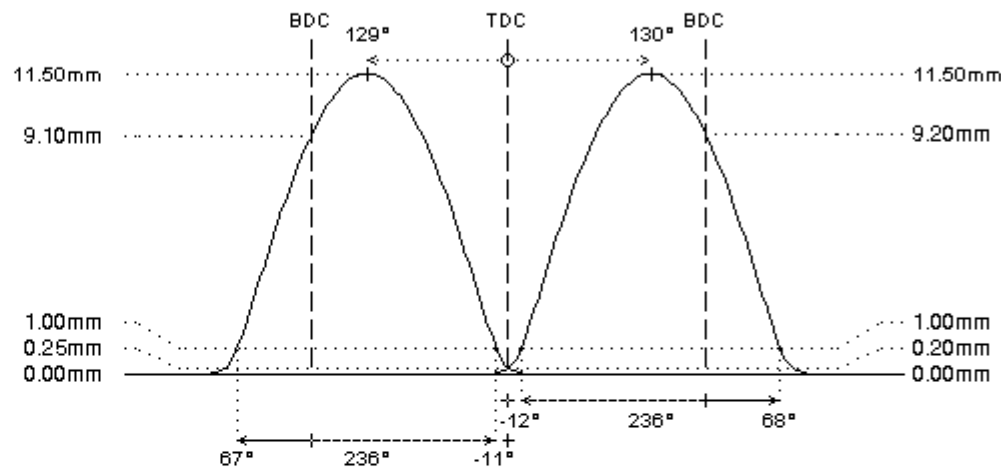
parts setup:

cam wheels :	:	:
follower	: O.E.M.	: O.E.M.
valve lash	: O.E.M.	: O.E.M.
valve	: O.E.M.	: O.E.M.
valve locks	: O.E.M.	: O.E.M.
upper retainer	: O.E.M.	: O.E.M.
lower retainer	: O.E.M.	: O.E.M.
exterior spring	: O.E.M.	: O.E.M.
interior spring	:	:

fitted load / length	: 0kg @ 0.0mm	: 0kg @ 0.0mm
max. load / lift	: 0kg @ 0.0mm	: 0kg @ 0.0mm

REMARKS :

original valve spring info is not available

**REMARKS :**

- # Check distance between valves and piston to be 1mm at least with VVT engaged. Wrong installation will cause severe engine damage!
- # ECU reprogramming advised