

2291204

full race

Ford HXJA Ti-VCT

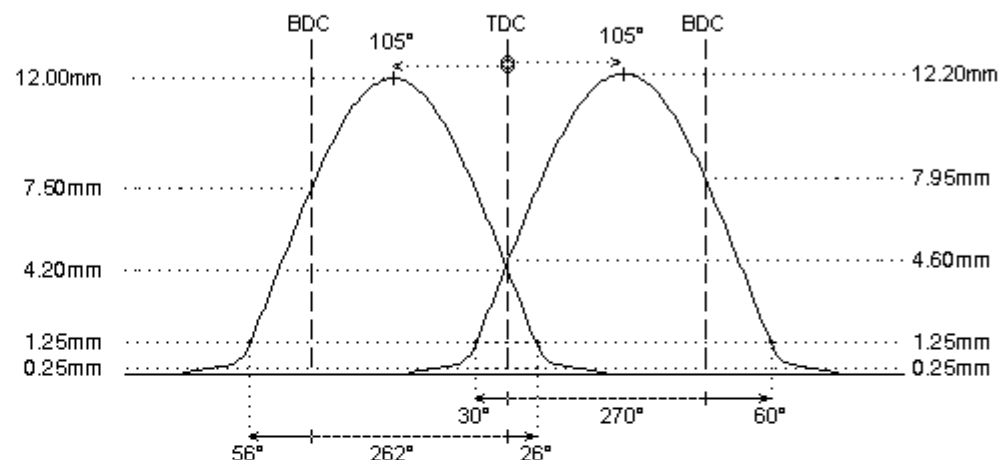
I-4cyl 1.6L 16v DOHC (DTx/DTx)



	intake	exhaust
camshaft data:		
lash ramp	: 0.25mm	0.25mm
duration @ 0.1mm	: 312°	304°
duration @ 1.0mm	: 270°	262°
valve lift	: 12.20mm	12.00mm
cam lift	: 12.20mm	12.00mm
lobe angle	: 105°	105°
timing @ 1.0mm	: 30° / 60°	56° / 26°
valve lift @ TDC	: 4.60mm	4.20mm
parts setup:		
cam wheels :	:	:
follower	: O.E.M.	: O.E.M.
valve lash	: O.E.M.	: O.E.M.
valve	: O.E.M.	: O.E.M.
valve locks	: O.E.M.	: O.E.M.
upper retainer	: ✗ not available	: ✗ not available
lower retainer	: ✗ not available	: ✗ not available
exterior spring	: ✗ not available	: ✗ not available
interior spring	:	:
fitted load / length	: 0kg @ 0.0mm	: 0kg @ 0.0mm
max. load / lift	: 0kg @ 0.0mm	: 0kg @ 0.0mm

REMARKS :

- # original valve spring info is not available
- # valve spring kit can be developed on request

**REMARKS :**

- # FOR COMPETITION APPLICATIONS ONLY. Following details must be verified:
 - the camshafts must turn smooth in the cylinderhead, provide free travel by machining where needed
 - distance between valve seal and retainer at full lift must be 0.6mm at least
 - minimum valve spring travel of 1.0mm at full lift must be provided
 - distance between valve and piston 1.0mm (pref. 1.5mm). check 5-15° before TDC on exhaust, and after TDC on intake
- # ONLY for use in competition engines with independent engine management (throttle position sensor) or carburetors
- # lock or limit range of VANOS system
- # Valve lift and timing data are illustrated on a locked centerline. The VANOS system changes the centerlines and therefore the timing data and lift on TDC.
 - The centerline and TDC data should not be used when installing the camshaft with full cam intake retard (disengaged VANOS system)!!! **WRONG INSTALLATION WILL CAUSE THE VALVES TO HIT THE PISTONS!!!**
 - We insist to install the VANOS camshaft(s) in such way that the distance between valves and piston is at least 1mm at full advance of the intake (or full retard at the exhaust)