

4003608

tarmac rally - race

Mercedes M113.960 .960 .962 .963 .964 .965 .966 .967 .968 .969 .971

V-8cyl 5.0L 24v SOHC (RPRH/RPRH)

**intake****exhaust****camshaft data:**

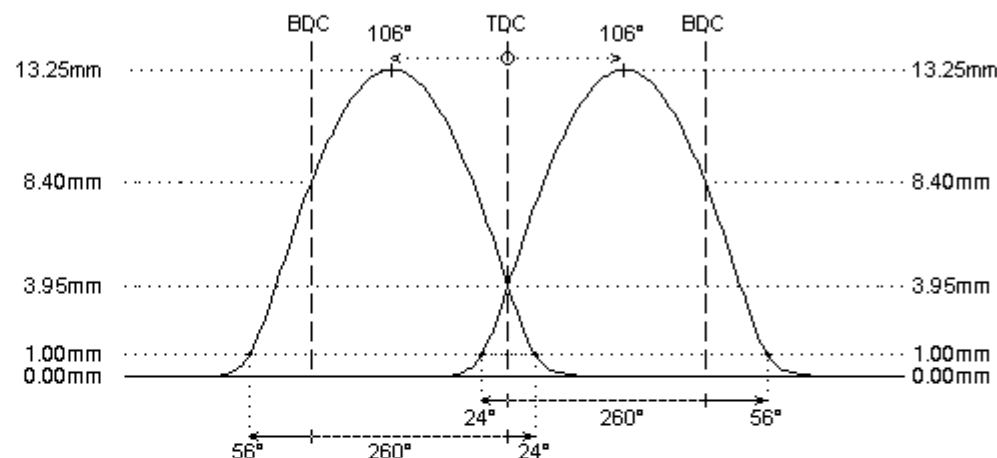
lash ramp	: hydro	hydro
duration @ 0.1mm	: 322°	322°
duration @ 1.0mm	: 260°	260°
valve lift	: 13.25mm	13.25mm
cam lift	: 9.30mm	9.30mm
lobe angle	: 106°	106°
timing @ 1.0mm	: 24° / 56°	56° / 24°
valve lift @ TDC	: 3.95mm	3.95mm

parts setup:

cam wheels :	:	:
follower	: O.E.M.	: O.E.M.
valve lash	: O.E.M.	: O.E.M.
valve	: O.E.M.	: O.E.M.
valve locks	: O.E.M.	: O.E.M.
upper retainer	: 99572	: 99572
lower retainer	: 99593/O	: 99593/O
exterior spring	: PAC-E92009	: PAC-E92009
interior spring	: PAC-I92009	: PAC-I92009
fitted load / length	: 35kg @ 34.0mm	: 35kg @ 34.0mm
max. load / lift	: 104kg @ 14.0mm	: 104kg @ 14.0mm

REMARKS :

machining of cylinder head required

**REMARKS :**

- # FOR COMPETITION APPLICATIONS ONLY. Following details must be verified:
 - the camshafts must turn smooth in the cylinderhead, provide free travel by machining where needed
 - distance between valve seal and retainer at full lift must be 0.6mm at least
 - minimum valve spring travel of 1.0mm at full lift must be provided
 - distance between valve and piston 1.0mm (pref. 1.5mm). check 5-15° before TDC on exhaust, and after TDC on intake
- # ONLY for use in competition engines with independent engine management (throttle position sensor) or carburetors
- # valve seals must be lowered. Distance between valve seal and retainer must be at least 0.6mm at full lift.